



PRESSURELUBE
INTERNATIONAL

DATE:		15/12/98		Customer:										
		Serviced							Stem Packing		To Cycle			
Tag No.	Service	Date	Type	Size	Class	Flush	Lube	Sealant	Replaced	Leaks	OK	Firm	Seized	Comments
G5			Gate	6	150						X	X		
C904-B	320 ISOL		Plug	6	150		.5			No	X			Serviced, Stem Seal to be change
C904-A	320IN	12/11/98	Plug	6	150		.5		24/06/98	No	X			Drill out & Tap ¼"npt, Install ¼" vent cap Fitting
C904-C	320OUT	12/11/98	Plug		150		.5							Installed LL# Fitting
C906-C	170		Gate	4	150							X		
C906-D	170		Ball	4	150							XX		Unable to Service
J902-S	Suction	12/11/98	Plug	4	150	-	0.5	-	Yes	No	X			Serviced Top-Up, stop collar is Broken
J902-S	Discharge	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced Top
J902-N	Discharge	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced Top
J902-N-A	Kick Back	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced Top
J902-N-B	Kick Back	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced Top
J902-N-C	Kick Back	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced Top
J902-N-A	Suction	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced Top
J902-N-B	Suction	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced Top
A	Prod/R/Down	12/11/98	Plug	4	150	-	0.5	-	30/12/97	No	X			Serviced Top
B	Prod/R/Down	22/06/98	Plug	4	150	-	0.5	-		Yes	X			Serviced, Valve Isolated service Next Time
C	Prod/R/Down	22/06/98	Plug	4	150	-	0.5	-		No	X			Serviced, Valve Isolated service Next Time
D	Prod/R/Down	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced
E	Prod/R/Down	12/11/98	Plug	4	150	-	0.5	-	Yes	No	X			Serviced, Insulation Box needs replacing
F	Prod/R/Down	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced, Inspect Stem Seal
G	R/D To Tank	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced, Inspect Stem Seal
H	R/D To Slops	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced, Inspect Stem Seal
	Tower Bypass	12/11/98	Plug	2	150	-	0.5	-		No	X			Serviced, Replaced Stem Packing
	Tower Suction	12/11/98	Plug	4	150	-	0.5	-		No	X			Serviced, Stem Seal Leaks, Check Next Month
	Inside Tower	15/05/98	Plug	3	150			0.5	11/09/97	No	X			Serviced, Top-Up, Adjusted Stem Seal
A	170 RETURN	-	Ball	6	150					Yes	XX			Unable to Service
B	170 RETURN	-	Ball	6	150								X	Need to Replace Valve. Unable to Service
A	170 RETURN	-	Ball	6	150								X	Need to Replace Valve. Unable to Service
	320 RETURN	-	Ball	6	150								X	Need to Replace Valve. Unable to Service
PDA	Blow Down	11/11/98	Plug	3	150	2		2		No	X	X		Serviced, Must Service every Month OR Seize